

Date: Wednesday, 4/5/2006 3:31:34 PM  
 User: Kim Johnston

## Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: MID TUBE ASSEMBLY
Job Number	: 26575		
Estimate Number	: 10469		
P.O. Number	: N/A	Part Number	: D3391023
This Issue	: 4/5/2006	S.O. No.	: N/A
Prsht Rev.	: NC	Drawing Number	: D3391 REV D
First Issue	: N/A	Project Number	: N/A
Previous Run	: 26574	Drawing Revision	: D
		Material	: N/A
Written By	: <u>SEE COMMENT BELOW</u>	Due Date	: 4/28/2006
Checked & Approved By	: <u>06.04.06</u>	Qty:	1 Um: Each
Comment	: Est. A 05.10.20 New Issue KJ/EC Est. B 06.02.10 ECN773 dwg rev.D EC		

## Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	D25001100	Skidtube Extrusion
-----	-----------	--------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

SKIDTUBE EXTRUSION

Pick:

Qty	Part Number	Description	Batch
1	D2500-1-100	Extrusion	B 24593 IT 06-04-07

2.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
-----	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1

1-Cut tube to finish length as per Dwg D3391 IT 06-04-07 ①

2-Identify as D3391-023 IT 06-04-07 ①

3-Drill pilot holes using DT8796 as per Dwg D3391 DP 06-4-7

4-Open float bag holes to Ø0.250" as per Dwg D3391 using DT8796D visual aid Jig BE 06-04-10 ①

5-C'sink float bag holes as per Dwg D3391 BE 06-04-10 ①

6-Open remaining holes to Ø0.375" BE 06-04-10 ①

7-Remove .030" from Fwd indexing Ridge as per Dwg D3391 DP 06-4-10

8-Remove indexing ridge on Fwd &amp; Aft end of skidtube as per Dwg D3391 DP 06-4-10

9-Deburr BE 06-04-11 ①

10-Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.208" holes with paint marker BE 06-04-11 ①

11-Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.208" (14 holes) as per Dwg D3391 BE 06-04-11 ①

12-Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.250" and c'sink (20 holes) as per Dwg D3391 BE 06-04-11 ①

13-Open .375" holes to .438" BE 06-04-11 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 4/5/2006 3:31:34 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: MID TUBE ASSEMBLY

Job Number: 26575

Part Number: D3391023

Job Number:



Seq. #:

Machine Or Operation:

Description :

114-Deburr and blow out all chips from inside tube

BF 06-04-11(1)

3.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

4.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

Pm 06-04-26(1)

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DP 06-5-2

6.0

D33891

Web



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEB

Pick:

Qty	Part Number	Description	Batch
1	D3389-1	Web	B26589
A/R		Sikaflex-241/-291	M100480

Sikaflex expire date: 06-11-01

Start: 06-05-02 Time: 1:00

Finish: 06-05-03 Time: 12:00

7.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

Bond web in place as per Dwg D3391 & QSI 015.

Adhere for 12 hours) 2T 06-05-02

8.0

NAS1330C3KB116

Insert



Comment: Qty.: 20.0000 Each(s)/Unit Total : 20.0000 Each(s)

Insert

Pick:

Qty	Part Number	Description	Batch
20	NAS1330C3KB116	Insert	M19349

PC 06/06/05

(1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 4/5/2006 3:31:35 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: MID TUBE ASSEMBLY

Job Number: 26575

Part Number: D3391023

Job Number:



Seq. #:

Machine Or Operation:

Description :

9.0

NAS1330C3KB166



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

RivnuT

Pick:

Qty Part Number

Description

Batch

10

NAS1330C3KB166

Insert

M100732

DL 06/06/05

(1)

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

Install inserts as per Dwg D3391

DL 06/06/05 (1)

11.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect each insert using DT8821

DL 06/06/05 (1)

12.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

Use paint screws to mask inserts.

DL 06/06/05 (1)

13.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DL 06/06/05 (1)

14.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: N/A

15.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

DL 06/06/05 (1)  
W 06/06/05

Job Completion



**Dart Aerospace Ltd**


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

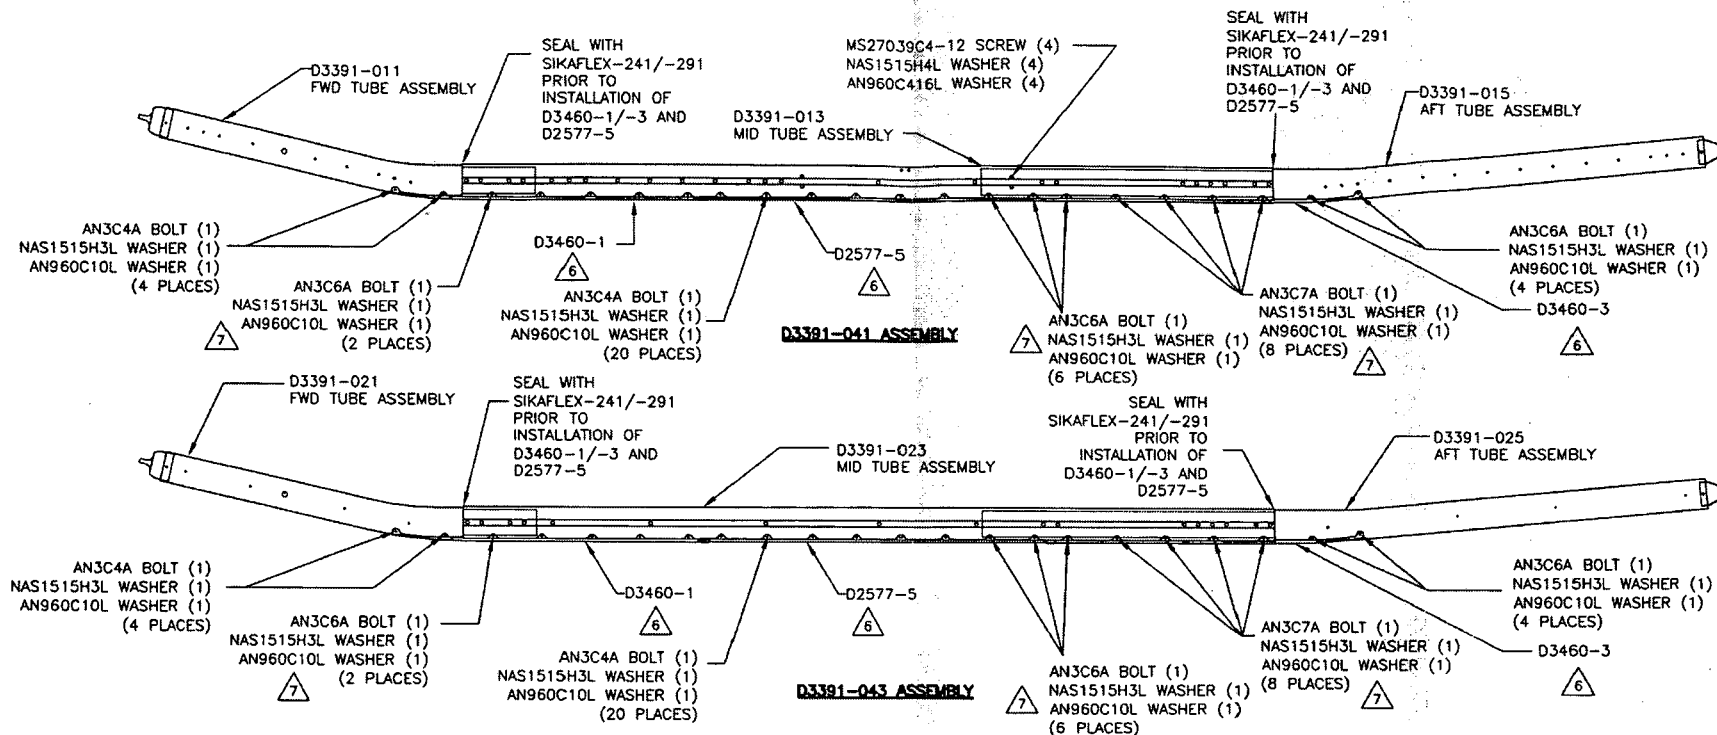

# D3391-041/-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY - 041	QTY - 043	PART NUMBER	DESCRIPTION
X	X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
		D3391-043	FLOAT SKIDTUBE ASSEMBLY
1		D3391-011	FWD TUBE ASSEMBLY
1		D3391-013	MID TUBE ASSEMBLY
1		D3391-015	AFT TUBE ASSEMBLY
	1	D3391-021	FWD TUBE ASSEMBLY
	1	D3391-023	MID TUBE ASSEMBLY
	1	D3391-025	AFT TUBE ASSEMBLY
24	24	AN3C4A	BOLT
12	12	AN3C6A	BOLT
8	8	AN3C7A	BOLT
44	44	NAS1515H3L	WASHER
44	44	AN960C10L	WASHER
4		MS27039C4-12	SCREW
4		NAS1515H4L	WASHER
4		AN960C416L	WASHER
1	1	D2577-5	WEARSHOE
1	1	D3460-1	WEARSHOE
1	1	D3460-3	WEARSHOE

## GENERAL NOTES

- ALL DIMENSIONS ARE IN INCHES
- TOLERANCES ARE PER DART QSI 018, UNLESS OTHERWISE NOTED
- FINISH: ACID ETCH AND ALODINE PER DART QSI 005 4.1  
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY. CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL 'E' SIZE HOLES (Ø0.250-Ø0.257) FOR WEARSHOE INSERTS. C'SINK Ø0.391/Ø0.425 x 100" AS APPLICABLE AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- APPLY A LAYER OF SIKAFLEX -241/-291 ADHESIVE BETWEEN THE BOTTOM OF THE SKIDTUBE ASSEMBLY AND THE WEARPLATES
- DO NOT TORQUE, HAND TIGHTEN ONLY

△

RELEASED









06-01-27

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


DESIGN	D	06.01.23	UPDATE TOLERANCE, CHANGE HOLE SIZE
C	05.09.27	LENGTHEN AFT EXTENSION	
B	05.06.10	DRAWING UPDATES	
A	05.02.07	NEW ISSUE	
DRAWN BY	PH	PH	DART AEROSPACE USA, INC.
CHECKED	PH	PH	DART AEROSPACE USA, INC.
DATE	06.01.23	DRAWING NO.	D3391
		TITLE	412 FLOAT SKIDTUBE
		REV. D	SHEET 1 OF 5
		SCALE	NTS

NO WORK ORDER  
26575  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
UNCONTROLLED COPY  
ENGINEERING  
RETURN TO  
SHOP COPY

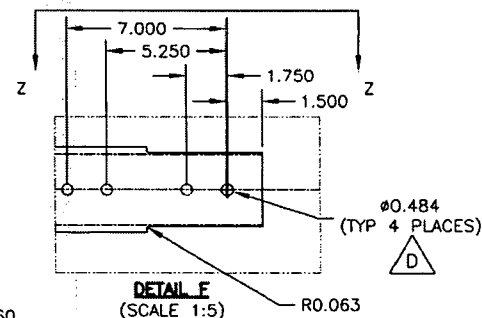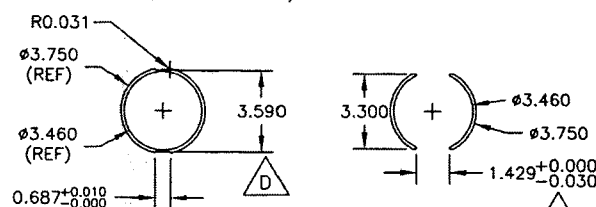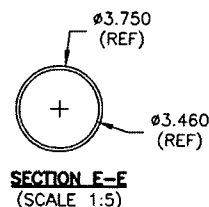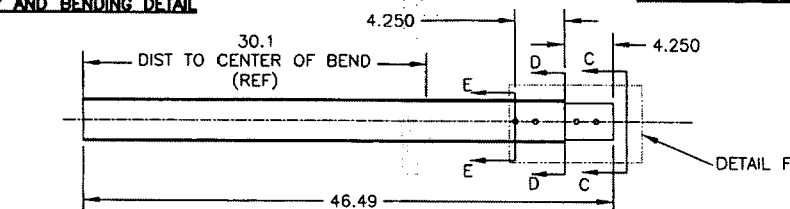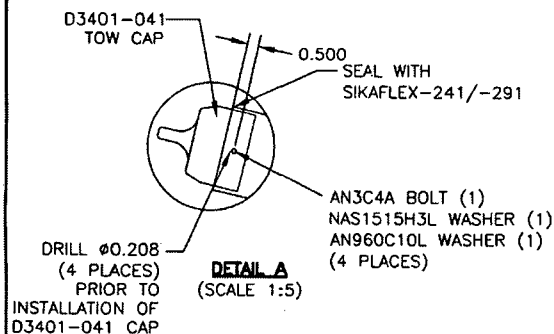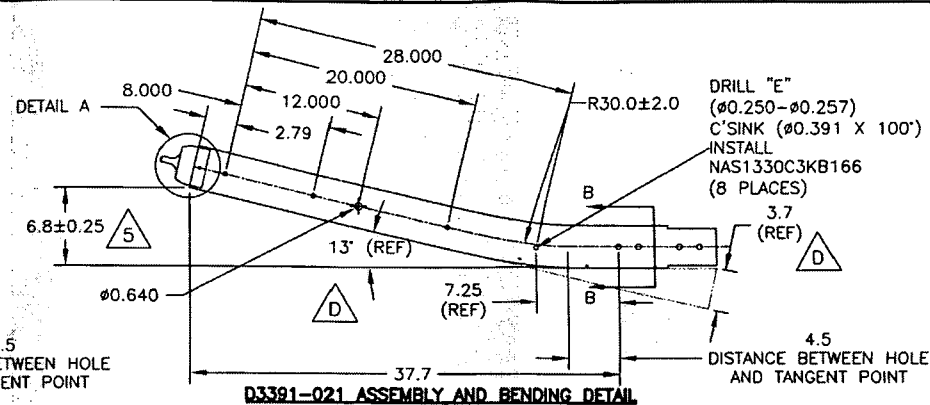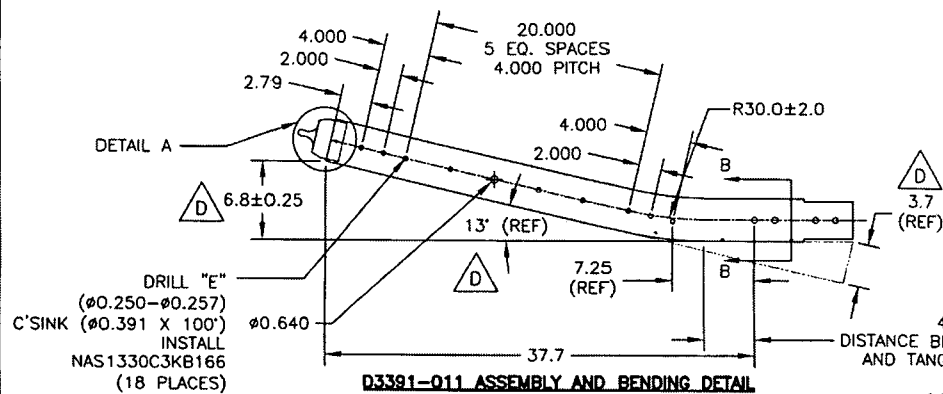

RELEASED

06-01-27

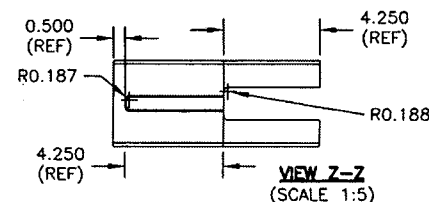

# D3391-011/-021 FWD TUBE ASSEMBLY PARTS LIST

QTY - 011	QTY - 021	PART NUMBER	DESCRIPTION
X		D3391-011	FWD TUBE ASSEMBLY
	X	D3391-021	FWD TUBE ASSEMBLY
1	1	D6013-047	FWD TUBE
1	1	D3401-041	TOW CAP
4	4	AN3C4A	BOLT
4	4	NAS1515H3L	WASHER
4	4	AN960C10L	WASHER
24	14	NAS1330C3KB166	INSERT

WORK ORDER  
265725  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
RETURN TO  
ENGINEERING  
HQP COPY

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.

DESIGN PH PH DRAWN BY PH PH

CHECKED PH APPROVED PH

DATE 06.01.23



DRAWING NO. D3391

TITLE 412 FLOAT SKIDTUBE



REV. D SHEET 2 OF 5

SCALE 1:10




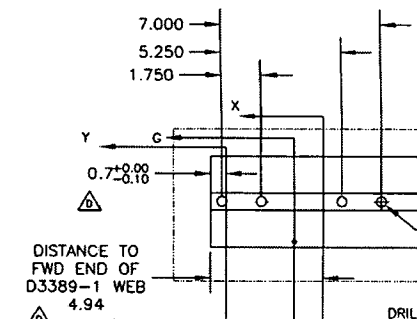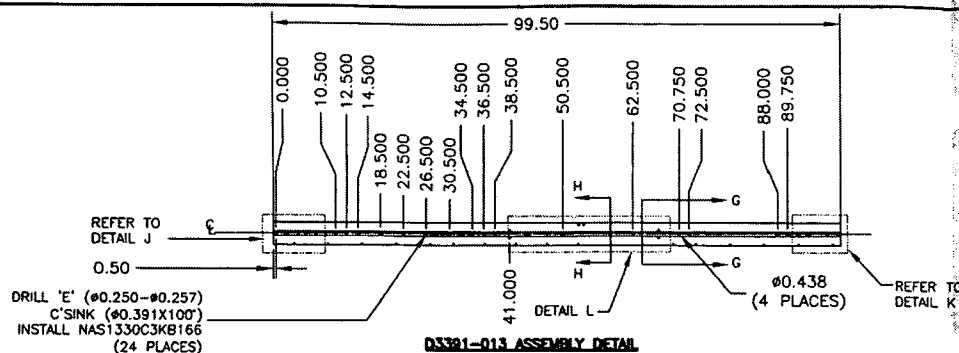


DRILL 'O' (#0.332-#0.338)  
INSTALL NAS1329C4KB140 INSERT  
MS27039C4-08 SCREW  
NAS1515H4L WASHER  
AN960C416L WASHER  
(TYP 4 PLACES)

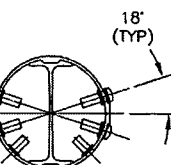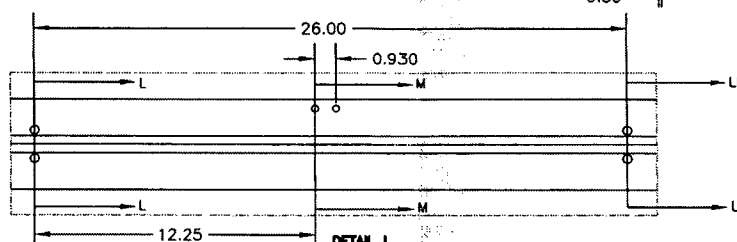

DRILL 'E' (#0.250-#0.257)  
C'SINK (#0.391X100)  
INSTALL NAS1330C3KB116 INSERT  
MS27039C1-09 SCREW  
NAS1515H3L WASHER  
AN960C10L WASHER  
(TYP 4 PLACES)

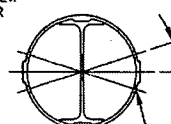

DRILL 'E' (#0.250-#0.257)  
(TYP 4 PLACES)

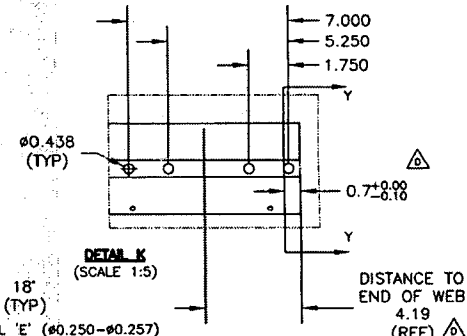

RELEASED  
06.01.23


**D3391-013/-023 MID TUBE ASSEMBLY PARTS LIST**

QTY - 013	QTY - 023	PART NUMBER	DESCRIPTION
X	X	D3391-013	MID TUBE ASSEMBLY
		D3391-023	MID TUBE ASSEMBLY
1	1	D2500-1-100	EXTRUSION
1	1	D3389-1	WEB
24	20	NAS1330C3KB116	INSERT
24	10	NAS1330C3KB166	INSERT
4		NAS1329C4KB140	INSERT
4		NAS1515H3L	WASHER
4		AN960C10L	WASHER
4		NAS1515H4L	WASHER
4		AN960C416L	WASHER
4		MS27039C1-09	SCREW
4		MS27039C4-08	SCREW


**D3391-013/-023 MID TUBE ASSEMBLY**

- MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER SUBJECT TO AMENDMENT


**SECTION I-I (SCALE 1:4)**

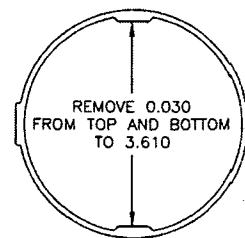


**SECTION X-X (SCALE 1:2)**

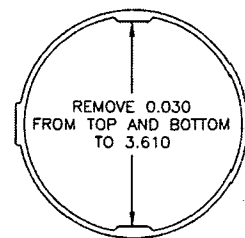


**SECTION M-M (SCALE 1:4)**

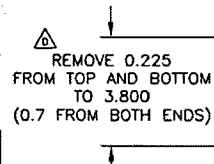


**SECTION II-II (SCALE 1:4)**

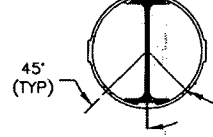

**SECTION G-G (SCALE 1:4)**

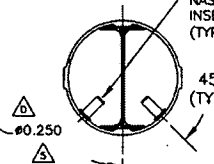


**SECTION H-H (SCALE 1:4)**




COPYRIGHT © 2006 BY DART AEROSPACE USA, INC.		DESIGN PH	DRAWN BY PH	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, OH
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CHECKED PH	APPROVED PH	
DATE 06.01.23		DRAWING NO. D3391		REV. D SHEET 3 OF 5
		TITLE 412 FLOAT SKIDTUBE		SCALE 1:20


SHOP COPY  
RETURN TO  
ENGINEERING  
CONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
20575

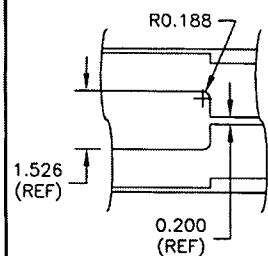

VIEW BB-BB  
(SCALE 1:3)

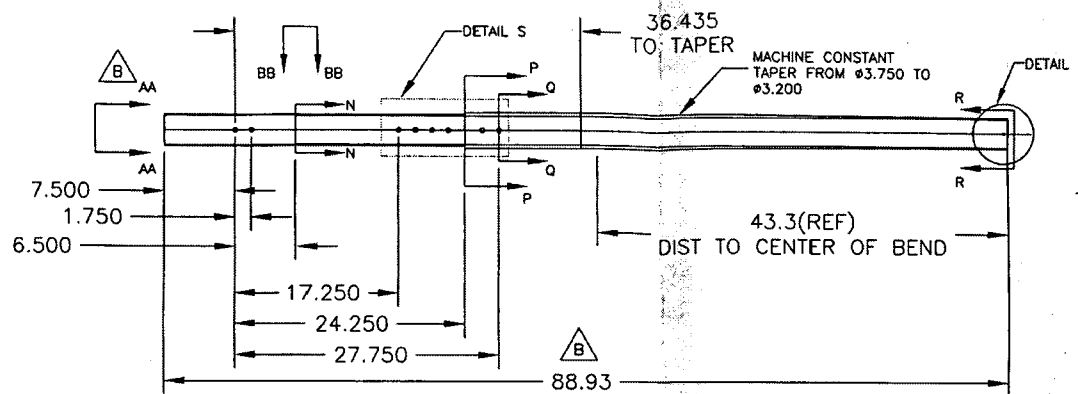


D3391-3 AFT DRILLING AND CUTTING DETAIL  
(MAKE FROM D6014-090 SKIDTUBE MATERIAL)

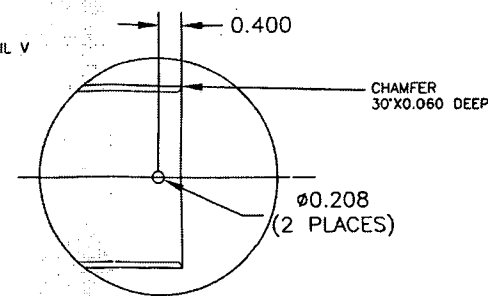


DETAIL V  
(SCALE 1:2)


RELEASED  
06-01-27

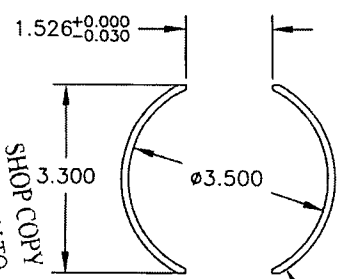


SECTION AA-AA  
(SCALE 1:2)

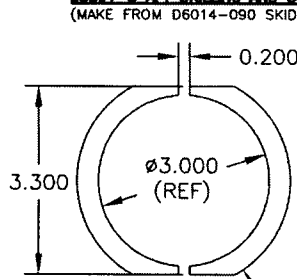


SECTION N-N  
(SCALE 1:2)

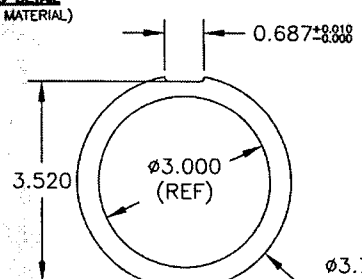

SECTION P-P  
(SCALE 1:2)

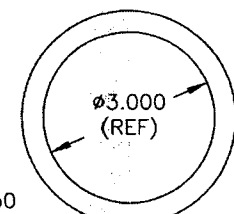


SECTION Q-Q  
(SCALE 1:2)

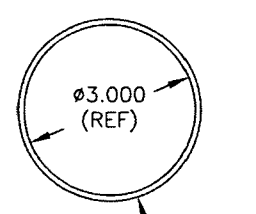


SECTION R-R  
(SCALE 1:2)

NO. 26575  
WORK ORDER  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
UNCONTROLLED COPY  
RETURN TO  
SHOP COPY  
ENGINEERING  
NO. 26575

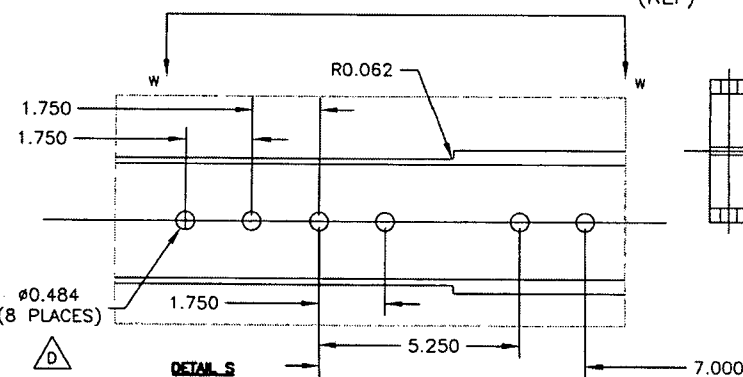

DETAIL S  
(SCALE 1:3)


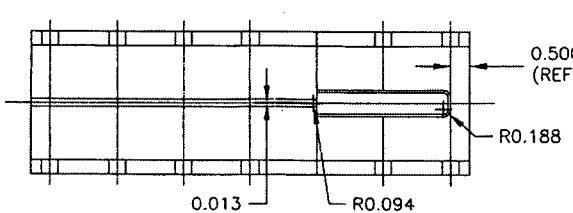


VIEW W-W  
(SCALE 1:3)



COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.  
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN PH	DRAWN BY PH	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, OH	REV. 0
CHECKED #	APPROVED #	DRAWING NO. D3391	SHEET 4 OF 5
DATE 06.01.23	TITLE 412 FLOAT SKIDTUBE	SCALE 1:12	

RELEASED  
06.01.27

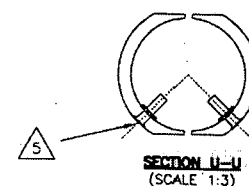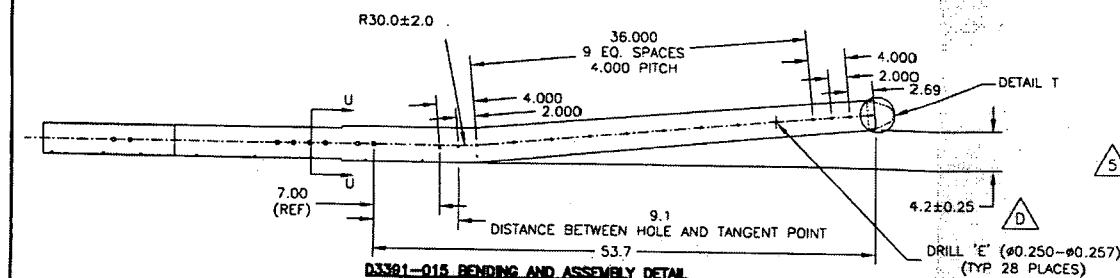


AN304A BOLT (1)  
NAS1515H3L WASHER (1)  
AN960C10L WASHER (1)  
(2 PLACES)

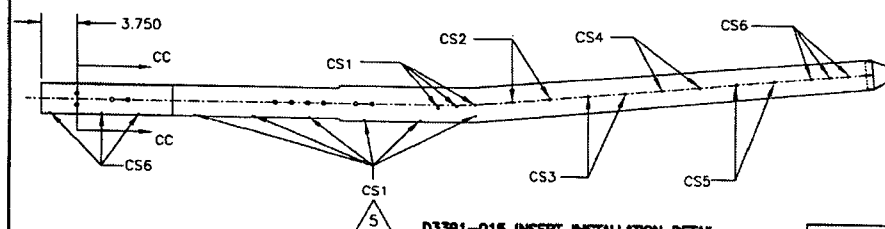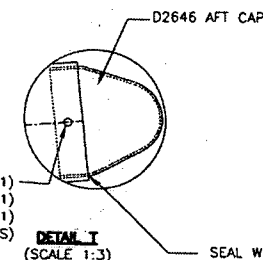

C'SINK AND INSTALL AESS10KBXXX AND/OR  
NAS1330C3KBXXX IN HOLES MARKED CS1-CS6 AS  
FOLLOWS


HOLES MARKED	QTY D3391-015	QTY D3391-025	C'SINK	P/N
CS1	18	14	Ø0.425	AESS10KB366
CS2	4		Ø0.391	AESS10KB366
CS3	4	2	Ø0.391	NAS1330C3KB316
CS4	4	2	Ø0.391	NAS1330C3KB268
CS5	4		Ø0.391	NAS1330C3KB216
CS6	12	8	Ø0.391	NAS1330C3KB166

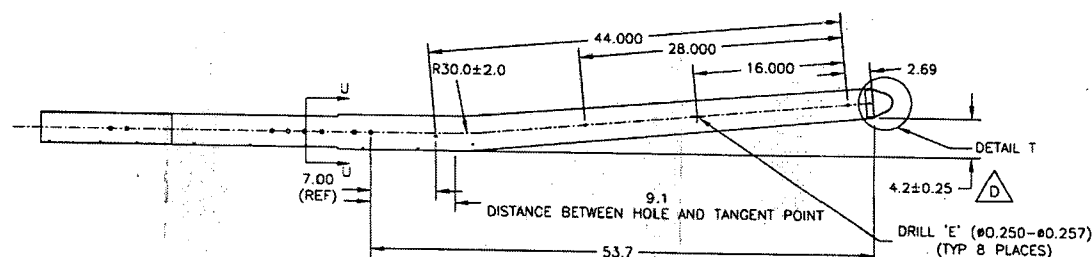


D3391-025 BENDING AND ASSEMBLY DETAIL

# D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X		D3391-015	AFT TUBE ASSEMBLY
	X	D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-090	AFT TUBE
1	1	D2646	AFT CAP
18	14	AESS10KB366	INSERT
4	2	NAS1330C3KB316	INSERT
4	2	NAS1330C3KB268	INSERT
4		NAS1330C3KB216	INSERT
12	8	NAS1330C3KB166	INSERT
4		NAS1330C4KB151	INSERT
2	2	AN304A	BOLT
2	2	NAS1515H3L	WASHER
2	2	AN960C10L	WASHER

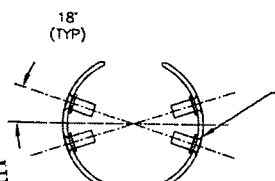

DRILL 'O' (Ø0.332-Ø0.338)  
C'SINK (Ø0.529X100Ø)  
NAS1330C4KB151 INSERT (1)  
(4 PLACES)

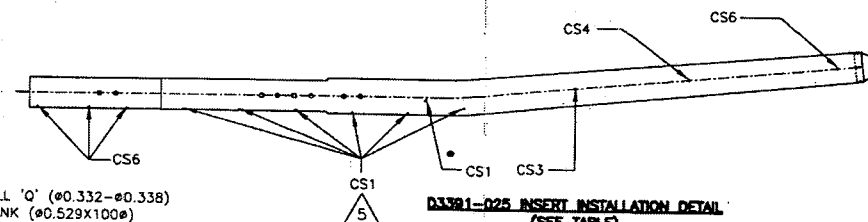

D3391-025 INSERT INSTALLATION DETAIL  
(SEE TABLE)

COPYRIGHT © 2005 BY DART AEROSPACE, USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL  
AND IS SUPPLIED ON THE EXPRESS CONDITION  
THAT IT IS NOT TO BE USED FOR ANY PURPOSE  
OR COPIED OR COMMUNICATED TO ANY OTHER  
PERSON WITHOUT WRITTEN PERMISSION FROM  
DART AEROSPACE USA, INC.

DESIGN PH	DRAWN BY PH	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, MA
CHECKED #	APPROVED #	DRAWING NO. D3391
DATE 06.01.23	TITLE 412 FLOAT SKIDTUBE	REV. D SHEET 5 OF 5 SCALE 1:12

UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
265715